


DATE	08-10
------	-------

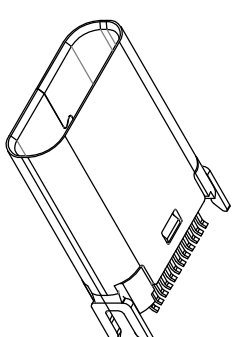


TEMPERATURE RANGE $-55^{\circ}\text{C} \sim +85^{\circ}\text{C}$

深圳市鑫风雷电子有限公司

Rohs 客户图

目錄 MAPX	變更內容 MODIFICATION	日期 DATE
A0	NEW	09-10-20

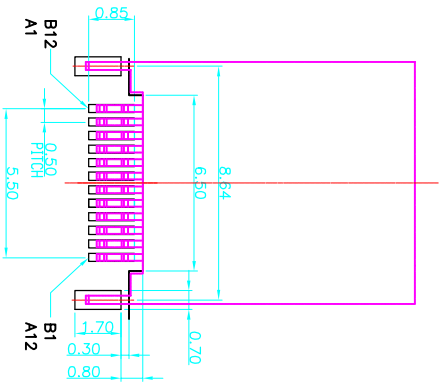

RECOMMENDED P.C.B. LAYOUT (T:1.00mm)
TOLERANCE UNSPECIFIED ±0.05mm


PIN	Signal Name	Description	PIN	Signal Name	Description
A1	GND	Ground return	B12	GND	Ground return
A2	SSTXp1	Positive half of first SuperSpeed TX differential pair	B11	SSRXp1	Positive half of first SuperSpeed RX differential pair
A3	SSTXn1	Negative half of first SuperSpeed TX differential pair	B10	SSRXn1	Negative half of first SuperSpeed RX differential pair
A4	Vbus	Bus Power	B9	Vbus	Bus Power
A5	CC1	Configuration Channel	B8	SBU2	Sideband Use (SBU) Channel
A6	Dp1	Positive half of the USB 2.0 differential pair-Position 1	B7	Dn2	Negative half of the USB 2.0 differential pair-Position 2
A7	Dn1	Negative half of the USB 2.0 differential pair-Position 1	B6	Dp2	Positive half of the USB 2.0 differential pair-Position 2
A8	SBU1	Sideband Use (SBU) Channel	B5	CC2	Configuration Channel
A9	Vbus	Bus Power	B4	Vbus	Bus Power
A10	SSRXp2	Negative half of second SuperSpeed RX differential pair	B3	SSTXn2	Negative half of second SuperSpeed TX differential pair
A11	SSRXp2	Positive half of second SuperSpeed RX differential pair	B2	SSTXp2	Positive half of second SuperSpeed TX differential pair
A12	GND	Ground return	B1	GND	Ground return

产品图 PRODUCT CHART DWG				深圳市鑫风雷电子有限公司			
公差一览表 TOLERANCE UNLESS OTHERWISE				UNITS	MM	制图 DRAWING	产品料号 PRODUCT PART NO.
X	±0.30	X'	±5°	SCALE	1:1	审核 CHKD	XFLF001-UCAF001-X
X	±0.25	X'	±2°				
XX	±0.30	XX'	±1°				
XXX	±0.15	XXX'	±0.5°	DATE	2009/10/20	核准 APPD	雷永健
						角法 VIEW	版本 VER
							AO

12345678910


Rohs 客户图

一、將成品依同一方向放入真空盤內,如圖所示:
At same direction, put product onto the tray.
Direction refers to below drawing.

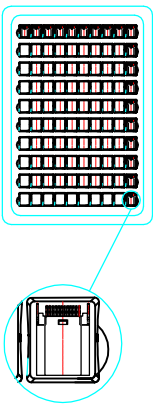


二、一只紙箱可放置之包裝盤(包括上蓋)見下表。
1) trays per carton,please see next table.

2) The Q'ty of products per carton please see next table.
3) Bind the trays with PE tape and then(a bundle of 10 trays),put them into the poly bag. Seal the carton with tape.

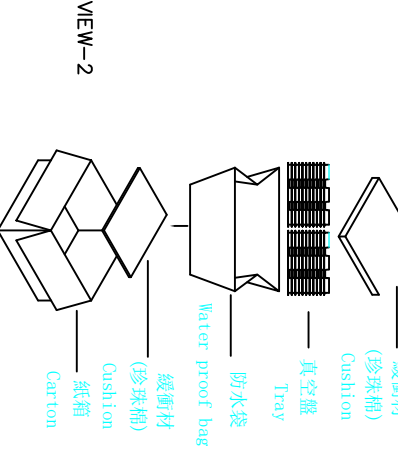

三、1). 將標籤貼於紙箱側麥上方。
Stick the needful label On the up-right corner of the side of carton.

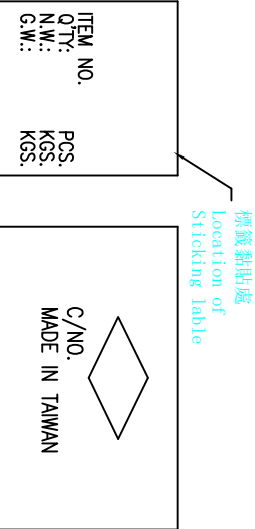

備註(REMARK)
1. 若有未裝滿之零數箱,必須以緩衝材塞滿。
The unfilling-carton must be filled with assuagement.
2. 防水袋需用膠帶貼實且封口。
waterproof plastic bag must be folded up.
3. 裝滿成品后之外箱,最大堆積箱數: 5箱
About the box fully filled with products, the MAX accumulating quantity of boxes is 5.
4. 如須貼Bar-code,請依Bar-code作業辦法執行
If barcode lable is required,do it according to the related barcode lable operation standards.

包裝明細表 (The detail of the packing)				
產品料號 (Product No.)	包裝容量	(Packing Capacity)	重量	
	pcs/box	boxes/Carton	Pcs/Box	N.W./Pcs N.W./Box G.W./Box
	100	70	7000	

產品圖 PRODUCT CHART DWG				深圳市鑫風雷電子有限公司			
公差一覽表 TOLERANCE UNLESS OTHERWISE				單位 UNITS	MM	制圖 DRAWING	王冠
X	±0.30	X'	±5°	比例 SCALE	1:1	審核 CHKD	雷永健
.XX	±0.30	.XX'	±1°	日期 DATE	2009/10/20	核准 APPD	雷永健
.XXX	±0.15	.XXX'	±0.5°	產品料號 PRODUCT PART NO.	XFLF001-UCAF001-X	產品名稱 PRODUCT NO.	TYPE C母座夾板1.0 L=10.5
				角法 VIEW	⊕	版本 VER	AO