

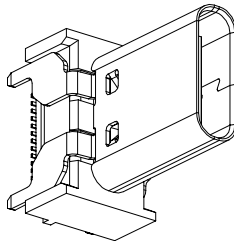


RoHS 客户图


目錄 MAPX	變更內容 MODIFICATION	日期 DATE
A0	NEW	09-10-20

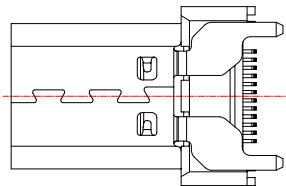




WITHOUT COVER

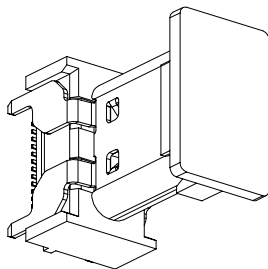


WITH COVER

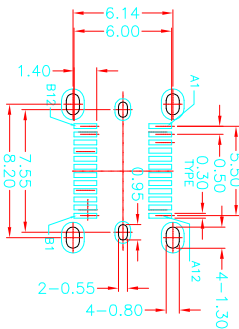

RECOMMEND P.C.B LAYOUT(COMPONENT SIDE)
TOLERANCE FOR PCB LAYOUT IS ± 0.05
KEEP OUT AREA

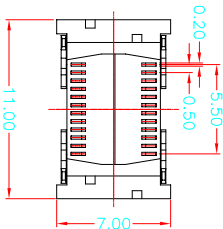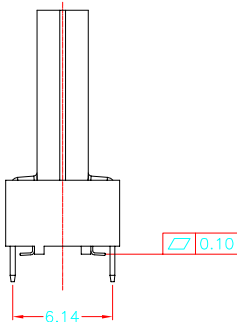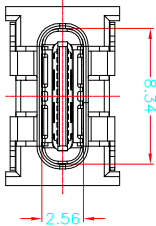

- 1.Contact Resistance:40mOHM Max.;
- 2.Dielectric Withstanding Voltage:100V AC For 1 Minute;
- 3.Insulation Resistance:100M OHM Min.;
- 4.Mating And Unmating Force:
Mating Force: 5~20N
Unmating Force: 8~20N(0~1000cycle);
6~20N(1001~10000cycle);
- 5.Durability:10000 Cycles;

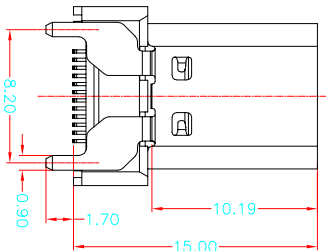

产品图

深圳市鑫风雷电子有限公司



公差一览表 TOLERANCE UNLESS OTHERWISE				单位 UNITS				制图 DRAWING				产品料号 PRODUCT PART NO.			
X	± 0.30	X'	$\pm 5^\circ$	比例 SCALE	1:1	审核 CHKD	王冠	产品名称 PRODUCT NO.	19011-UCAF003-X	角法 VIEW	版本 VER	19011-UCAF003-X			
X	± 0.25	X'	$\pm 2^\circ$	日期 DATE	2009/10/20	核准 APPD	雷永健	TYPE C 24P母座180度SMT H=15.0							
.XXX	± 0.15	.XXX'	$\pm 0.5^\circ$												

RoHS 客户图





目錄 MAPX	目 錄 A0	設 變 內 容 MODIFICATION	日 期 DATE
		NEW	09-10-20

包装规范说明:

1. 如图所示首先CARRIER TAPE (载带) 需先预留8PCS空格后方可置入成品,并贴COVER TPAE(上带)覆盖于上,再配合带接机自动卷绕于REEL(塑胶卷轴)收料.
2. As shown from picture, the initial starting carrier need to be emptied for 8 pcs, then put connector on lath carrier; Then cover it with Cover Tape, and Reeling it with Reel auto machine .
3. 在定量包装完成后,前贴CARRIER TAPE外需预留8PCS空格,而COVER TPAE配合CARRIER TYPE长度覆盖后,并须再超出200mm以上,最后以喷拉贴面,并于REEL盘上方贴合格标签和ROHS标签各一张.
4. In the end of the Reel, need to empty 8 pcs carrier tape; After covering the carrier, then the Cover Tape need to be 200mm longer, and use tape to fix the cover tape to the reel. Put "RoHS label" and "Qualified label" on the tape.
5. 注意:COVER TAPE不可浮起或有翘附不顺,垂缩及成品放置方向错误之现象.
6. Attention: no deformation of Cover Tape is allowed (prottruded plastic, or not smooth, bednt or product is wrong positioned)
7. 在纸箱内左右,前后侧各放入一块三角卡板,每个PE袋中放入8个REEL盘,并在PE袋中放入2PCS干燥剂,用胶带封好,在每个纸箱内装入10PCS卷盘,共1叠,盖上前盖后以胶带封箱,于侧位置贴出货标签和RoHS标签各一张.
8. Inside of carton, at left and right side, put triangle fixed card; Put 10Reels to PE bag, and put 1 bags of desiccant inside the PE bag. Each carton has 8 reels. Put "RoHS label" and "Delivery label" on side of the carton.
9. 5. 零箱部分, 出货时须用缓冲物填满.
10. The fractional box must be filled by cushion before shipment.

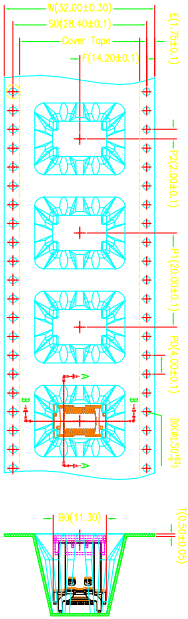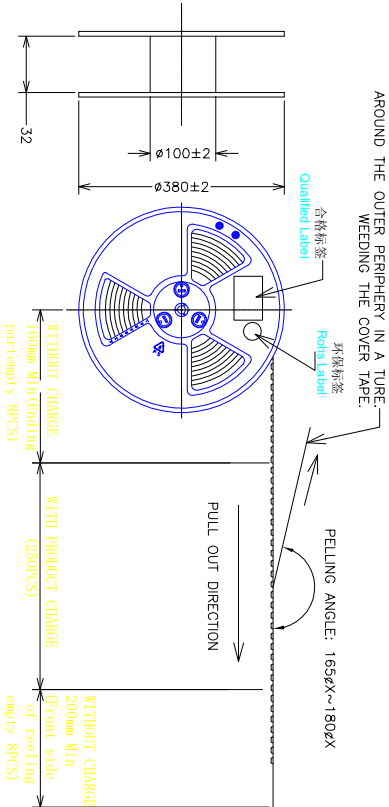

产品放置载带中时, 铜合面方向可以不一致!

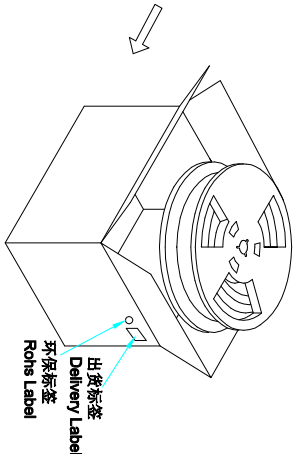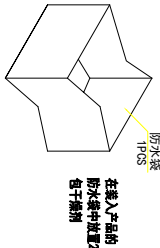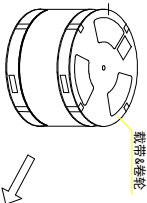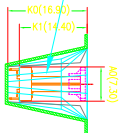

环保标签(ø25MM)
RoHS Label

产 品 规 格	/
Product spec.	/
包装 Pack/Reel	200
容量 Cap/Box	8
QTY 个/箱 Pcs/Box	1600
净重 N.W.	/kg
毛重 G.W.	/kg

产品图

深圳市鑫风雷电子有限公司

公差一览表 TOLERANCE UNLESS OTHERWISE				单位 UNITS	MM	制图 DRAWING	王冠	产品料号 PRODUCT PART NO.	19011-UCAF003-X
X	±0.30	X'	±5°	比例 SCALE	1:1	审核 CHKD	雷永健	产品名称 PRODUCT NO.	TYPE C 24P母座180度SMT H=15.0
.XX	±0.20	.XX'	±2°	日期 DATE	2009/10/20	核准 APPD	雷永健	角法 VIEW	版本 VER
XXX	±0.15	.XXX'	±0.5°						A0